

Release Note

Software Release 2.3.4

For AR100 Series Internet Routers

Introduction

Allied Telesyn announces the release of Software Release 2.3.4 for AR100 Series Internet Routers. This Release Note describes the issues resolved in Software Release 2.3.4.

This Release Note should be read in conjunction with the AR100 Series Internet Router Software Reference for Software Release 1.9.4, available on the support site at www.alliedtelesyn.co.nz/support/ar100/.



WARNING: Information in this document is subject to change without notice and does not represent a commitment on the part of Allied Telesyn International. While every effort has been made to ensure that the information contained within this document and the features and changes described are accurate, Allied Telesyn International cannot accept any type of liability for errors in, or omissions arising from the use of this information.

Enhancements and Resolved Issues

Software release 2.3.4 includes the following enhancements and resolved issues:

- On AR160 routers, when eth0 was set as the DHCP client with the SET IP INTERFACE DHCP command, BOOTP packets continued to be sent after an IP address was assigned to the router. This issue has been resolved so that BOOTP packets are not sent when eth0 is the DHCP client.
- When dual firewall policies were defined, public to private passive mode FTP transfers sometimes failed. This issue has been resolved.
- After about 250 days of uptime, the *uptime* and *last change* fields in the output of some SHOW commands displayed incorrect values for some interfaces. This issue has been resolved.

- Trigger scripts for event triggers did not receive the correct state information for PPP. This issue has been resolved.
- Charge management correctly prevented PPP from coming up when the currency limit was exceeded. However, the check for the currency limit was not done until after the ISDN call was activated. Customers approaching the charge limit would have incurred a small additional charge even though the ISDN call was subsequently cancelled by charge management. This issue has been resolved.

Availability

Software Release 2.3.4 is available immediately as a FLASH release for upgrading existing routers. The release file can be downloaded directly from the Software Updates area of the Allied Telesyn web site at www.alliedtelesyn.co.nz/support/updates/patches.html or from the support site for your router: www.alliedtelesyn.co.nz/support/ar100/.